

ES210 Animal & Vet Scale

User's Manual (V1611)



Anyload Transducer Co. Ltd

Website: www.anyload.com
Email: info@anyload.com
Fax: +1 866 612 9088

North America Toll Free: 1-855-ANYLOAD (269 5623)



TABLE OF CONTENTS

1.	Introduction	2
2.	Safety Recommendations	2
3.	Structure and Installation	3
4.	Packing List	3
5.	Buttons and Functions	3
6.	Operation	4
	6.1 Turn on	4
	6.2 Turn off	4
	6.3 Weighing	4
	6.4 Calibration Methods	4
	6.5 Switching Unit	6
	6.6 Keeping Function "Hold"	6
	6.7 Print output function	6
	6.8 Counting Sample	6
	6.9 Serial Port Printout	7
7.	Parameters Settings	8
8.	Cue Codes	10
9.	Maintenance	10
10.	Troubleshooting	11
11	Specifications	11



1. Introduction

Thank you for purchasing the Anyload ES210 series Animal and Vet Scale. The ES210 animal & Vet Scale measures force and weighs of an object through the use of a high-precision load cell, processes data by microcomputer, and displays data by LCD indicator. Features include simplicity of operation, quick measurement, high precision and stability, etc. The scale includes a removable rubber mat preventing animals from slipping while also featuring a side handle for easy portability. Its platter is made of stainless steel for easy clean up and is ideal for veterinarian clinics or agricultural settings. These Vet scales series include a digital indicator with multiple functions such as auto shut off, auto calibration, auto zero tracking and stability indication. Additionally, the ES210 vet scales also have a unit button to switch among kilograms, pounds and counting function as well as adjustable feet to ensure accurate weighing.

Anyload ES210 animal and veterinary platform scales are used for weighing small and medium sized animals and applicable in veterinary hospitals as well.

This manual provides the user's guide in using the product, safety, installation, features and technical specifications, calibration procedures, configurations and other technical related in using the scale.

2. Safety Recommendations

When using this weighing equipment the following recommendations shall be observed for safety:

The weighing machine may only be used with the power adapter supplied exclusively for use with the weighing machine.

Before inserting the power adapter, the user must ensure that the operating voltage stated on the power adapter agrees with the mains voltage.

If not, please contact Customer Service at the address above.

If the power adapter or its cable is damaged, the weighing machine must immediately be disconnected from the electricity supply (pull out the power adapter).

The weighing machine may only be operated from mains electricity supply with a power adapter which is in perfect condition.



If there should be any reason to believe that it is no longer possible to operate the weighing machine without danger, the weighing machine is to be immediately unplugged from the electricity supply (pull out power adapter) and secured against inadvertent operation.

3. Structure and Installation



4. **Packing List**

- (1) Animal Scale 1 piece
- (2) AC Adapter 1 piece
- (3) Instruction 1 copy
- (4) Guarantee Statement 1 copy

5. **Buttons and Functions**

Key	Button	Function	Menu Function	Serial port order code
(U)	Power Button	Turn on/off	Null	0
Unit	Unit Button	Switch the unit	Go Down on menu or parameters	U
Hold	Hold Button	Hold / Print function	Go Up on menu or parameters	Н
Enter Button		Tare	Enter menu or confirm the change of parameters	Т



6. Operation

6.1 Turn on

Adapter: Insert the plug of AC Adapter into the power supply hub which is on the left of the Display Indicator, and insert the AC Adapter into AC socket.

Battery: Open the battery cover which is on the right of the Display Indicator, load 4 x AAA alkaline cells into the cell box (note the polarity) and then close the battery cover.

Empty the platform, press button once, it will show all the characters then the Maximum Capacity and Division. After the screen displays "0", you can begin to measure the object.

6.2 Turn off

When power-on, press **(U)** button to turn off the scale.

6.3 Weighing

When power-on, with nothing on the platform, press Sutton once, the instrument will then display "O". Place an object on the platform. After the "kg", "lb" or "pcs" character stops flashing, which means that the data is stable, you can begin to read it.

6.4 Calibration Methods

6.4.1 Random Single-point Calibration

- a) At weighing mode, press and hold button until the window displays"------":
- b) Press or button to enter calibration mode;
- c) Press 😽 button to make sure enter the calibration mode;
- d) After entering the calibration mode, the window will display"Load"and"0.0kg" alternately, which means that the weight"0.0kg" should be loaded on the platform;
- e) After making sure that there is nothing on the platform, press button to confirm so that the scale begins "0.0kg" calibration. In the process of "0.0kg"calibration, "0.0kg" will flicker rapidly on the display window; keep the platform calm, stable, and without other interference factors which will



influence the weighing performance. If the weighing remains stable for longer than 2s, the scale will finish "0.0kg" calibration automatically, it will then begin the next calibration point; otherwise, "0.0kg" will keep flickering to wait for the scale to stabilize.

- f) Suppose that the next calibration point should be "xx.xkg", the window will display "Load" and "xx.xkg" alternately, which means that the weight "xx.xkg" (WEIGHT) should be loaded on the platform. If you have to change this weight, you can press on the button to enter the modify menu; then press on button to change the flashing position and press button to make the flashing position's number plus 1, and press 😽 button to make sure the modification is finished;
- g) After making sure the weight on the platform is "xx.xkg", press 🛞 button to confirm so that the scale begins the "xx.xkg" calibration. In the process of"xx.xkg" calibration, "xx.xkg" flickers rapidly on the display window; keep the platform calm, stable, and without other interference factors which will influence the weighing performance. If the weighing remains stable for more than 2s, the scale will finish "xx.xkg" calibration and save the calibrated parameters, then will return to the weighing mode; otherwise, "xx.xkg" will keep flickering until the scale stable

6.4.2 Standard Two Point Weight Calibration

- a) At weighing mode, press and hold button until the window displays "-------";
- b) Press or button cycle the display until the window displays"Line";
- c) Press button to begin calibration procedure;
- d) After the scale begins to calibrate, the window will display "Load" and "0.0kg" alternately;
- e) After you confirm that there is nothing on the platform, press button to confirm and begin the zero calibration when the window displays"0.0kg". In the process of zero calibration, "0.0kg" flickers rapidly on the display window; please keep the platform calm, stable, and without other interference factors which will influence the weighing performance. If the weighing keeps stable exceeding 2s, the scale will finish zero calibration automatically, and then it will



begin the next calibration point, otherwise, "0.0kg" will keep flickering to wait for the stable weighing

f) Repeat the step d) and step e) above, calibrate the half capacity range point and the Full capacity range point orderly, save the calibrated parameters automatically and return to the weighing mode.

6.5 Switching the Unit

Press the button to switch the unit of measurement, kg --- lb--- pcs--- kg.

6.6 Keeping Function "Hold"

Once the key is pressed:

- **6.6.1** The CPU will send the weight data into RS232 socket.
- **6.6.2** The weight will remain on the display for 120 seconds after the item has been removed from the scale so the weight can easily be read.
- a) Place the item on the scale platform.
- b) Wait for the stable weights to be displayed.
- c) Press the key. The "▶" hold indicators will turn-on.
- d) Remove the item from the scale platform. The item's weight reading will remain on the display for 120 seconds.
- e) Quit to hold function: Once an item is weighed and the hold function is enabled; when you want to quit to hold function, press the key again to cancel the "▶" hold indicator and return the scale to weight value

6.7 Print output function

Press and hold the for 2 seconds, then the buzzer will sound, and the weight data will output to the computer or the serial printer.

6.8 Counting Sample


- a. During counting mode, remove unrelated objects on the platform, then press button to revert to zero;
- b. Press button to switch the unit into "PCS", and the window will display "ADD10".



- c. "ADD10" means that 10 objects to be weighed should be added onto the platform. Attention: The weight of each sample should be higher than the scale's minimum division value; otherwise, the window will display wrong cue "no".
- d. If you want to change the sampling quantity, please press the button to change the quantity; if you do not need to sample again, press the **(time)** button to cancel the sampling, and the scale will adopt last sampling value to count;
- e. After you confirm the quantity of objects on the platform and the data displayed on the LCD are the same, short press (50) to confirm, and then begin to sample and count;
- f. During the process of sampling and counting, the screen will display the sampling data by rapidly flickering; keep the platform calm, stable, and without other interference factors which will influence the weighing performance. If the weighing stays stable longer than 2s, the sampling and counting will be automatically finished, the parameter will be saved automatically and the scale will return to counting mode; if not, the screen will keep flickering the data and waiting for the stability of measuring.

6.9 Serial Port Printout

a. Connect the serial port with the scale according to the drawing below. Baud Rate=9600, without parity digit, sent stop bit 1 (The serial connection diagram is omitted);

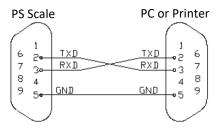

- b. Open the serial communication software, for example, "HyperTerminal" in windows. Select the connected portal number "COM" and set the baud rate as 9600bps, the parity bit as "NONE", the data bit as "8Bit", and the stop bit as "1Bit".
- c. You can select the serial output modes according to your own needs. The output modes include 3 types: output by pressing button, automatic output after the weight keeps stable, and continuous output. You can set though the "out" in "Parameter setting".



- d. Output Data Form: 8 bytes data bit + 3 bytes unit code + 2 bytes ending code. The above-mentioned characters are all ASCII codes, and the unit can be kg, lb
- e. The serial ports order can be found in Chapter 2 "button function".

Example of Output Data

Display	Data Bit						Unit Code			Ending Code			
	1	2	3	4	5	6	7	8	9	10	11	12	13
123.45kg	Blank	Blank	1	2	3		4	5	k	g	Blank	CR	LF
-123.45lb	Blank	-	1	2	3		4	5	1	b	Blank	CR	LF
123.0pcs	Blank	Blank	Blank	1	2	3	•	0	р	С	S	CR	LF

6.10 When the scale is on, press and hold key until the display "OFF" or "ON", then release. That means open or close the function of animal weighing. When the action symbol which is above the units symbol flashes, that means the current mode is animal mode. in this state, once the weighing is locked, it will automatically remain locked weighs for about 10 seconds

7. **Parameters Settings**

- a) When the scale is off, please press button together with the button to turn on the scale. Do not release the button until the screen displays "----"**:**
- **b)** Press the or button to switch the menu;
- c) Press the ____ button to enter the display menu;
- d) After entering the display menu, press the on or button to select the parameter;
- e) Press the 😽 button to confirm the parameter, and return to the menu;
- f) After all the parameters have been set, switch the menu to "-End-", and press the **button** to finish the setting and save the parameters, then return to the weighing or counting mode.



Parameters Table:

Menu	Meaning of Menu	Selectable Parameter	Meaning of Parameter
1. codE	Check the internal code	null	Check the internal code for debugging by manufacturer.
2. ASt	Zero tracking range	0.5/1/2/3d	Set automatic zero tracking range.
3. out	Printout method	kEy/Auto/Conti	kEy: printout while press the key, Auto: printout automatically, Conti: printout continuously
4. LEd	Backlight control method	OFF/Auto/on	OFF: backlight is turned off , Auto: backlight is automatic, On: backlight is turned on.
5. OFF	Automatic shutdown control	no/3/510/15/30 /60 min	no: no automatic shutdown; 3~60min: if there is not any action of weighing objects or pressing buttons, the instrument will automatically turn off.
6LL-	Set Lower limit alarm	xxxx(lower limit value)	If the lower limit value is set to"0", the lower limit alarm function is canceled.
7HH-	Set upper limit alarm	xxxx (upper limit value)	If the upper limit value is set to"0", the upper limit alarm function is canceled.
-End-	Finish measuring and save the parameters	null	



8. **Cue Codes**

Display	Meaning of Code	Solution		
Code				
no	The calibration weight value is not loaded according to the display when calibrating. The quantity of objects is not loaded according to the quantity of sampling.	1. Load the weight value according to the show value. 2. Load the quantity according to the show value.		
AC	The batteries are brownout.	1. Use new batteries.		
		2. Use power adapter.		
Err-0	The calibration data is lost	Re-calibrate.		
	2. The load cell or main board	2. Change the Loadcell or main		
	maybe damaged.	board.		
Err-1	1. The weight is over the max	1. Remove the objects on the		
	capacity.	platform.		
	2. Lost the calibration data.	2. Re-calibrate.		
	3. The load cell or main board	3. Change the loadcell or main		
	maybe damaged.	board.		
L	Lower limit alarm	1. cancel lower limit alarm		
H	Upper limit alarm	1. cancel upper limit alarm		

9. Maintenance

In order to keep the scale's normal operating, the crust of indicator and the platform of scale should be kept clean and prevented from corrosion by foreign substance. If necessary, you should use a piece of cloth with mild washing agent to clean them. When you don't use the scale, pull out the A/C plug. If not being used in a long time, please take out the batteries



Troubleshooting 10.

Cause	Reason	Solution
No display	The power plug is not	Insert the plug in right
	inserted in the right	place.
	place.	Use the new batteries.
	The batteries are	
	expired.	
Low-voltage	The batteries power is	Use the new batteries.
indication	low.	
Error in weighing	The scale didn't back to	Do not put objects on the
data-reading	zero before using.	platform, press 🐷
	The scale is not	button, and then begin to
	calibrated.	weight.
		Re-calibrate.
False calibration	The calibration weight is	Use the precise calibration
	not precise.	weight.

11. **Specifications**

Model	ES210
Capacity x Readability	200×0.05kg
Pounds (lb)	440×0.1lb
Parts counting	Standard
Repeatability (std.dev)	0.05kg
Linearity	±0.05kg
T range	To capacity by subtraction
Over range capacity	Capacity + 9d
Stabilization time	2sec
Sensitivity drift (%)	0.01
Operation	10∼40 C
temperature	
Power requirements	110 or 220V 50/60Hz AC adapter (included); Or 4
	AAA batteries
Platform size (mm)	900×600
Dimensions	900×600×85 (W×L×D) (mm)
Net weight (kg)	12.5
Shipping weight (kg)	14.6